


PARTS LIST


PARASTEER™

LIT NO: SP-163


DATE: February 2011

REVISION: C

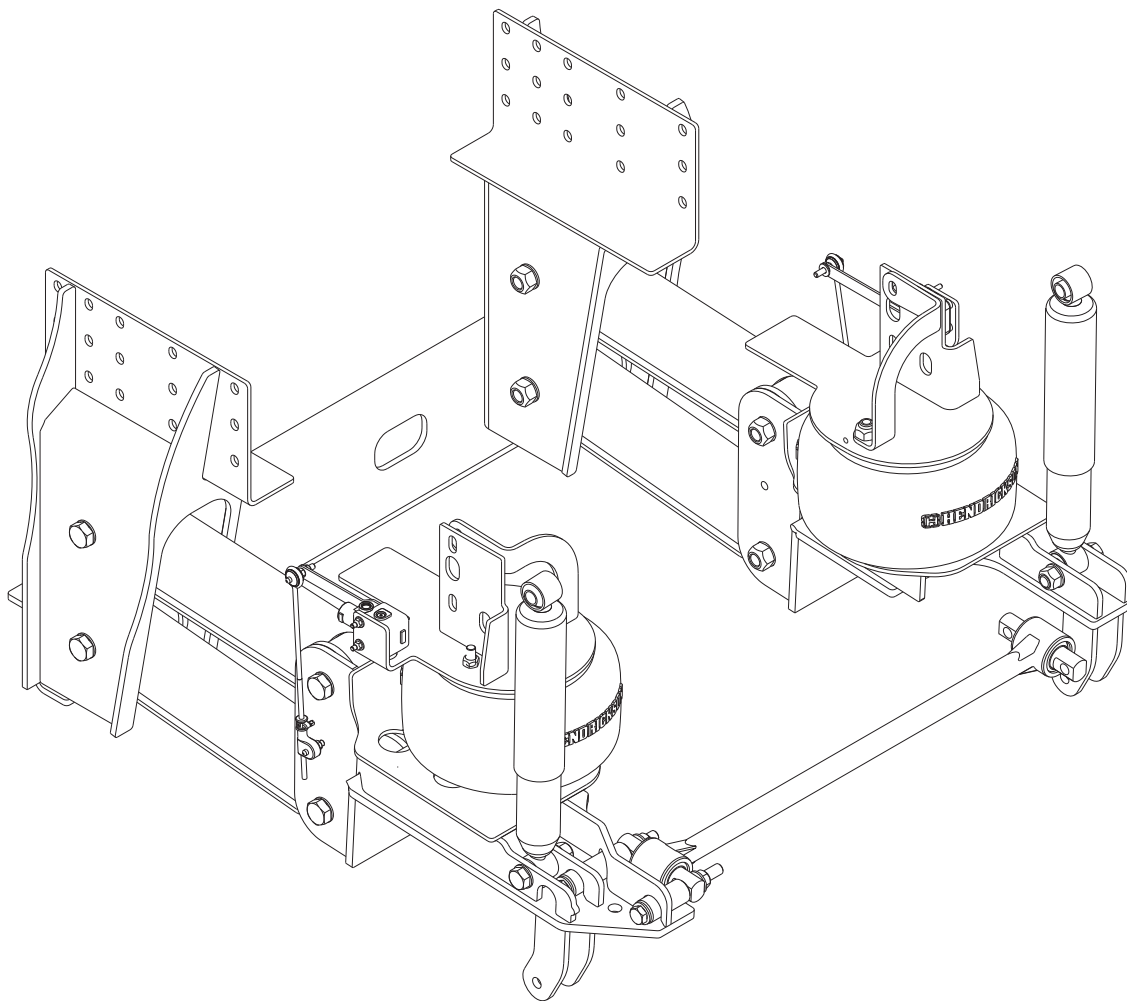

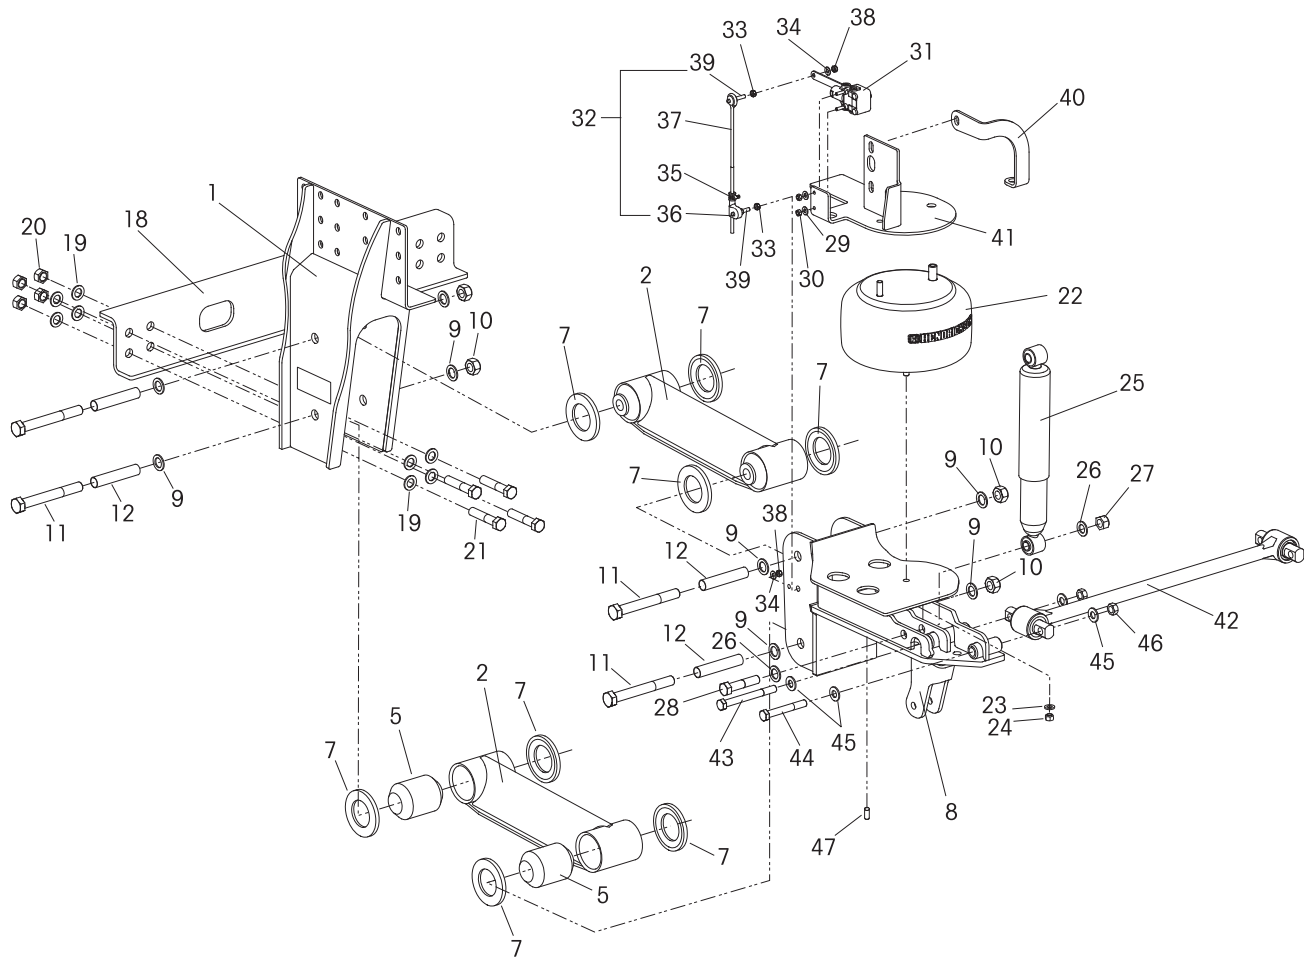

- Models built between 9/98 through 12/99 configuration

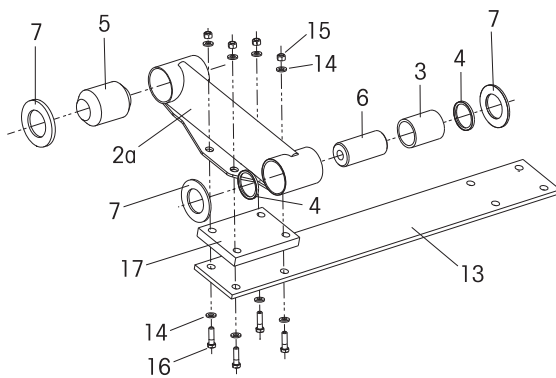



KEY NO.	PART NO.	DESCRIPTION	NO.REQ.	KEY NO.	PART NO.	DESCRIPTION	NO.REQ.
1	59521-001	LH Frame Hanger	1	17	59524-000	Spacer Plate TCFE/CSFE HDFE 9/98-12/99 (No Spacer Plate Needed for TCRE/CSRE, TSFE/CIFE, HDRE)	2
	59521-002	RH Frame Hanger	1	18		Cross Member	1
2	59536-000	Beam Assembly • Models w/Transverse torque rod 1/00-current, Includes Key No. 5	4		59538-000	• Models w/transverse torque rod 1/00-current	
2a	34013-108	Lower Beam Assembly Service Kit, One Side • Models w/transverse leaf 9/98-12/99 Replaces 59533-000, Includes Key Nos. 3-6			59540-000	• Models w/transverse leaf 9/98-12/99	
		HPS Bushing Service Kit, Axle Set,			50763-011	Cross Member Fastener Service Kit, Axle Set, Includes Key Nos 19-21, • Models w/transverse torque rod 1/00-current • Models w/transverse leaf, One Side 9/98-12/99	
	34013-105	• Models w/transverse torque rod, 1/00-current, Includes Key Nos. 5, 7		19	22962-001	¾"-Hardened Flat Washer	16
	34013-100	• Models w/transverse leaf, 9/98-12/99, Includes Key Nos. 3-7		20	49842-000	¾"-10 UNC Locknut	8
3	59526-001	PTFE Bushing • Models w/transverse leaf 9/98-12/99	2	21	50764-007	¾"-10 UNC 2.25" Bolt, Replaces 50764-011	8
4	59527-000	Rubber Seal • Models w/transverse leaf 9/98-12/99	4			Air Spring Fastener Service Kit, Axle Set, Includes Key Nos. 22-24	
5	59528-001	Beam Bushing • Models w/transverse torque rod, 1/00-current • Models w/transverse leaf 9/98-12/99	8 6		49177-007	Blue Bird TCRE/CSRE, TCFE/CSFE/HDRE, HDFE, QBRE/C4RE	
6	59498-001	Inner Metal • Models w/transverse leaf 9/98-12/99	2		49177-008	Blue Bird TSFE/CIFE (Flat Floor)	
7	59803-000	Thrust Washer	16	22		Air Spring	2
8		*Axle Seat			59484-002	Blue Bird TCRE/CSRE, TCFE/CSFE/HDRE, HDFE, QBRE/C4RE	
		• Left Hand	1		59601-002	TSFE/CIFE (Flat Floor)	
	64207-001	Blue Bird TCFE w/Standard Floor/CSFE, HDRE Replaces 60310-001 & 59491-001		23	22962-014	½"-Hardened Flat Washer	2
	64208-001	Blue Bird TSFE/CIFE, TCFE w/Flat Floor		24	17700-010	½"-13 UNC Nylocknut	2
	64209-001	Blue Bird HDFE, Replaces 60212-001 & 59503-001		25		Shock Absorber	2
	64210-001	Blue Bird C4RE			60665-005	• 9/98-11/01, Replaces 59483-000	
		• Right Hand	1		60998-002	• 11/01-current	
	64207-002	Blue Bird TCFE w/Standard Floor/CSFE, HDRE Replaces 59491-002		26		**Washer	4
	64208-002	Blue Bird TSFE/CIFE, TCFE w/Flat Floor		27		**Locknut	2
	64209-002	Blue Bird HDFE, Replaces 59503-002		28		**Bolt	2
	64210-002	Blue Bird C4RE			59013-000	Height Control Valve Service Kit, One Side, Includes Key Nos. 29-31	
		* Axle Seat Service Kit, Axle Set Replaces 60303-001, 59515-002, & 59515-001, (Blue Bird TSFE/CIFE, TCFE w/ Flat Floor)		29	22962-028	¼"-Hardened Washer	4
	64412-001			30	49983-000	¼"-20 UNC Locknut	4
	64412-002	Replaces 60320-001, 59509-002, & 59509-001 (Blue Bird TCRE/CSRE, & QBRE)		31	60501-000	Height Control Valve	2
	59568-001	Pivot Bolt Kit, Axle Set, Includes Key Nos. 9-12		32	58994-010	Height Control Valve Linkage Assembly, Includes Key Nos. 33-39	2
9	22962-002	7/8" Hardened Flat Washer	16	33		***5/16"-18 UNC Nut	
10	50106-000	7/8"-9 UNC Locknut	8	34		***5/16"-Hardened Washer	
11	59563-001	7/8"-9 UNC 7.5" Pivot Bolt	8	35		***Valve Arm Clamp	
12	59504-000	Plastic Liner	8	36		***Adjustment Valve Arm Joint	
13	59485-000	Transverse Leaf 9/98-12/99	1	37		***Extension Rod	
		Transverse Leaf Fastener Service Kit, Axle Set, 9/98-12/99, Includes Key Nos. 14-16		38		***5/16"-18 UNC Locknut	
	59565-001	Blue Bird TCRE/CSRE, TSFE/CIFE, HDRE		39		***5/16"-18 UNC Stud	
	59565-002	Blue Bird TCFE/CSFE			59553-000	HPS Air Spring Bracket Axle Service Kit, Includes Key Nos. 40-41	
	59565-003	Blue Bird HDFE		40	59479-003	LH Air Spring Reinforcement Bracket	1
14	22962-001	¾"-Hardened Flat Washer 9/98-12/99	16		59479-004	RH Air Spring Reinforcement Bracket	1
15	49842-000	¾"-10 UNC Locknut 9/98-12/99	8	41	59482-001	LH Upper Air Spring Hanger	1
16		¾"-10 UNC Bolt 9/98-12/99	8		59482-002	RH Upper Air Spring Hanger	1
	50764-007	2.25"-Blue Bird TCRE/CSRE, TSFE/CIFE, HDRE Replaces 50764-011		42	62000-745	Transverse Torque Rod • 1/00-current, Replaces 32271-117	2
	50764-005	3.0"-Blue Bird TCFE/CSFE			49176-010	Transverse Rod Fastener Service Kit • 1/00-current, Includes Key Nos. 44-47	
	50764-010	4.25"-Blue Bird HDFE		43	32043-007	5/8"-11 UNC 7.0" Hex Bolt	1
				44	32043-019	5/8"-11 UNC 5.5" Hex Bolt	1
				45	22962-004	5/8"-Hardened Washer	4
				46	47764-000	5/8"-11 UNC Locknut	2
				47	59537-001	Dowel Pin	2

NOTE: * The following axle seat part numbers must be replaced in pairs with the appropriate axle seat service kit:
59515-001, 59515-002, 60303-001 replaced by 64412-001 and 59509-001, 59509-002, 60320-001 replaced by 64412-002.

** Not supplied by Hendrickson, used for reference only. Refer to OEM (vehicle manufacturer) for more information and assistance with maintenance and rebuild instructions on these components. Hendrickson is not responsible for components supplied by vehicle manufacturer.

*** Item included in assembly only, part not sold separately.

This is a general parts list to provide directional information. Components may vary by model. Questions in regards to parts, contact Hendrickson Truck Parts toll-free at 866.755.5968 or email: truckparts@hendrickson-intl.com.

www.hendrickson-intl.com



Truck Suspension Systems
800 South Frontage Road
Woodridge, IL 60517-4904 USA

630.910.2800
Fax 630.910.2899